


V-RIG

R1 CABLE MANAGEMENT GUIDE






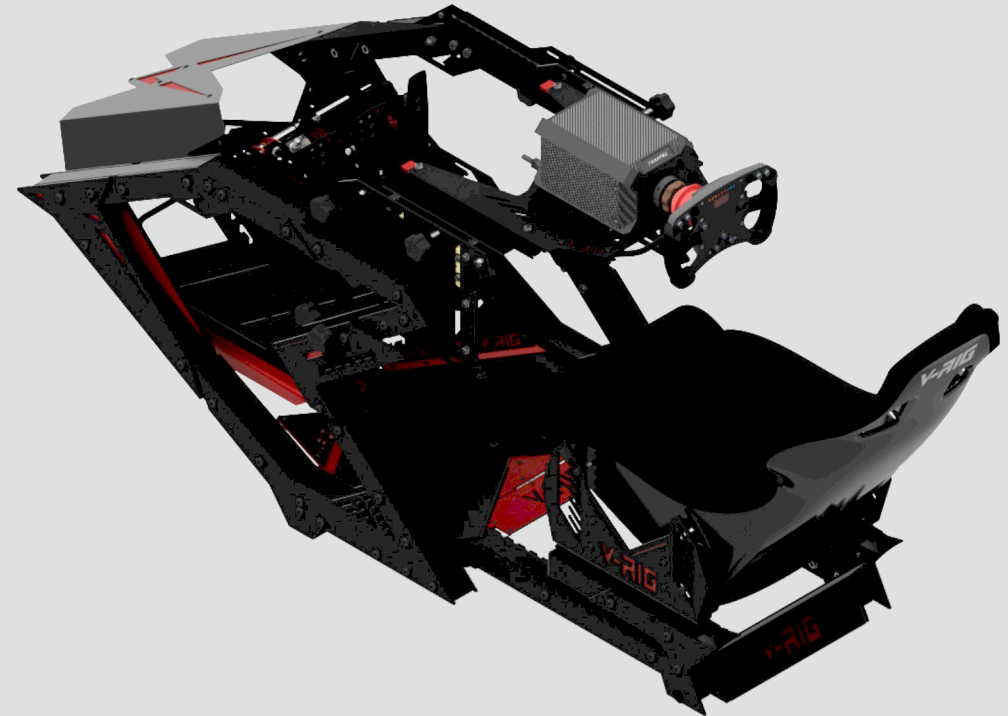

CABLE MANAGEMENT

The V-RIG R1s cable management design has allowed for an easy solution for cable management. The cables can easily be ran through the box section design to hide cables to give the simulator a clean and tidy look.

The V-RIG R1 Pedal Deck has holes for the passing of cables. On the pedal deck we advise using the smaller hole in the middle shown in the illustration. When fitting the pedals and running the cables make sure the pedal deck is set in the highest position. This is to allow slack for when pedals are adjusted in the future. Once fed through the pedal deck, 3 large circular holes can be found. We advise using the middle hole if pedals are adjusted often. The most forward or back hole can be used if the sim pedals are sat in a desired position without moving too often, this is to prevent snagging or damage to the cables. (Dependent on what pedals are used certain holes may not be available to use due to holes being covered). Depending on what pedals you have this may also change how your cables are run. Some pedals require the power of pedals to be run through the wheel such as the G923, whilst other pedals can be plugged into the PC.

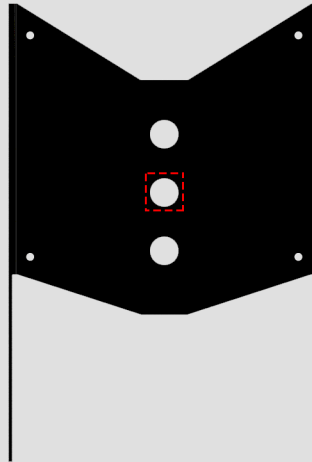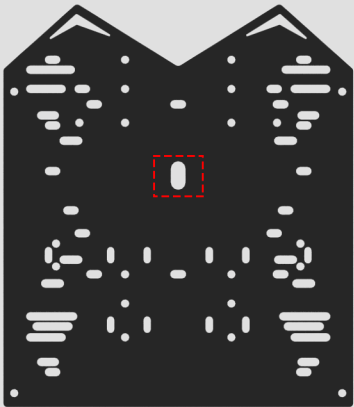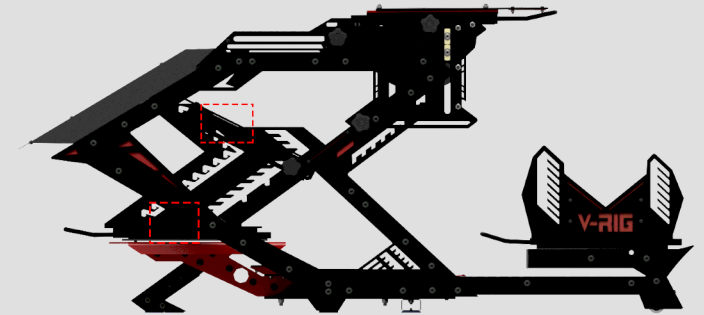

When fitting the wheelbase, you can either run the wheelbase cables down the left or right hand side. It will be best running the cables down the same side of which your PC is located. The illustration below shows the location of the front cable management hole on the right arm.

When running the cable down the arm, as it reaches the angle there are cut out holes to allow the cable to go round that bend. Feed it further down using the second hole shown on the second illustration.

When it reaches the bottom, another hole will allow the cable to be pulled out of the arm. This hole can be seen on the bottom of the first illustration.

When out the bottom of the arm there are available cable tying locations to make the cables secure when under the rig. These can be found on the red cable protection plate which can be seen on illustration 3.

The last step for running the wheelbase cable is getting it through the foot towards your PC. This is done by running it through the core cable hole seen in illustration 4 and then out of the foot box section.

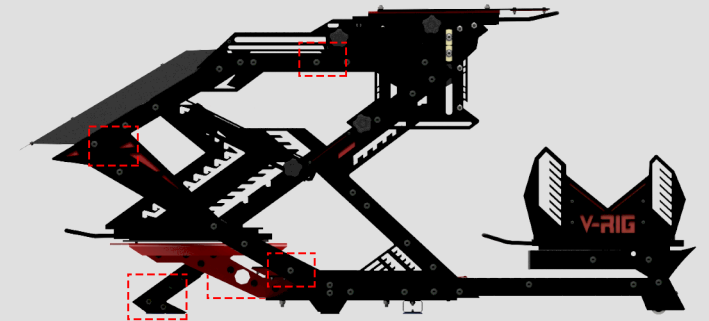


ILLUSTRATION 1



ILLUSTRATION 2

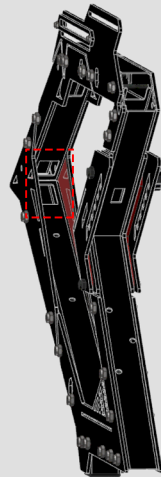


ILLUSTRATION 3

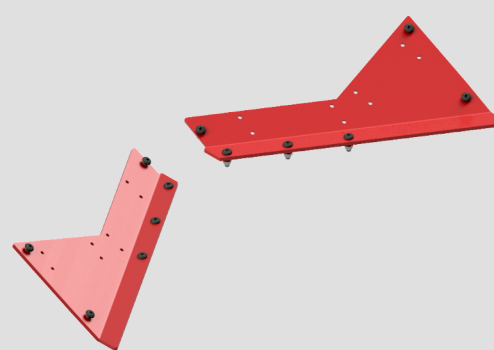


ILLUSTRATION 4

